

RECORDS OF FRIABLE AND NONFRIABLE ACBM
(FORM B)

Inspection Date(s): June 7, 2018

THREE-YEAR REINSPECTION

					CDS CODE 57 10579 6056568	
SCHOOL Greengate School					SCHOOL PHONE NUMBER (530) 668-6700	
ADDRESS	(NUMBER)	(STREET)	(CITY)	(ZIP)		
285 W Beamer St			Woodland	95695		

-IMPORTANT-

Each building and functional space with friable ACBM or friable assumed ACBM listed on this form requires completion of Form C (PHYSICAL AND HAZARD ASSESSMENT OF FRIABLE ACBM OR FRIABLE ASSUMED ACBM). Indicated location of material on blueprint, diagram or narrative in square or linear feet, and attach a copy. (Sec. 763.93).

LINE	BUILDING NAME & FUNCTIONAL SPACE (Indicate Address if Different From Above)	CHECK ONE			CHECK ONE			
		SUR-			ACBM		ASSUMED ACBM	
		FACING	TSI	MISC	FRIABLE	NON-FRIABLE	FRIABLE	NON-FRIABLE
1.	BUILDING A	X		X	X	X		X
2.	BUILDING B	X		X		X		X
3.	BUILDING C	X		X		X		X
4.	BUILDING D	X		X		X		X
5.	BUILDING E	X		X		X		X
6.	BUILDING F	X		X		X		X
7.	SHED A			X				X
8.	SHED B							
9.	MAINTENANCE BUILDING	X		X				X
10.								
11.								
12.								
13.								
14.								
15.								
16.								
17.								

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate - Form B.wpd

See attached "Homogeneous Materials Records" for all materials and their locations by building. On Form B all buildings are listed, and a summary of all non-friable and friable material is provided. Friable materials and their locations are listed separately under each building on Form B.

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: A

Material Class	Material	Homo. Mat. #	% Asb.	F ² (S)/L.F.(L)	Location	Condition: Code & Comments	Friable Yes/No
M	Carpet/Adhesive	1	Assumed Positive	1,500 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" White with Blue Spots Vinyl Floor Tile	2	Assumed Positive	300 S	Break room, restroom hall	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Beige with Brown Streaks Vinyl Floor Tile	3	5% CHRYSOTILE	500 S	Visible in storage room, assumed to exist beneath carpet flooring	(1) Sample 46574 analyzed on 2-25-89	N
M	Light Gray/White Speckled Sheet Vinyl Flooring	4	30% CHRYSOTILE	150 S	Restrooms (4)	(1) Sample 46575 analyzed on 2-25-89. Asbestos containing linoleum may be enclosed beneath newer sheet vinyl flooring	N
M	6" Blue Base Cove Adhesive	5	Assumed Positive	200 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	6	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	7	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Acoustic Ceiling Tile	8	Assumed Positive	1,000 S	Throughout except principal's office & conference room	(1) Material may have been sampled in 1989, unable to confirm	N
S	Spray Applied Acoustic Ceiling	9	10% CHRYSOTILE	600 S	Principal's office & conference room	(1) Sample 46569 analyzed on 2-25-89	Y

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR. wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: B

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	Carpet Adhesive	10	Assumed Positive	2,500 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Beige with Brown Streaks Vinyl Floor Tile	11	5% CHRYSOTILE	4,000 S	Throughout except kitchen, restrooms, wash room, kitchenette. Assumed present beneath carpet	(1) Sample 46577 analyzed 2-25-89	N
M	12" White with Blue Streaks Vinyl Floor Tile	12	Assumed Positive	750 S	Laundry & storage area - small building annex	(1) Material may have been sampled in 1989, unable to confirm	N
M	Linoleum (Unknown Color)	13	30% CHRYSOTILE	475 S	Restrooms, wash room	(7) Records indicate material was removed in 2002 by PARC Specialty Contractors	n/a
M	Beige Speckled Sheet Vinyl Flooring	14	Assumed Positive	475 S	Restrooms, wash room	(1) Installed in 2002	N
M	Base Cove Adhesive	15	Assumed Positive	200 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	16	Assumed Positive	5,500 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	17	Assumed Positive	5,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Acoustic Ceiling Tile	18	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: C

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" Beige with Brown Streaks Vinyl Floor Tile	19	5% CHRYSOTILE	2,700 S	Throughout	(1) Sample 46593 analyzed 2-25-89	N
M	12" White with Blue Spots Vinyl Floor Tile	20	Assumed Positive	250 S	Main Area	(1) Material may have been sampled in 1989, unable to confirm	N
M	Lincleum (Unknown Color)	21	30% CHRYSOTILE	380 S	Restrooms	(7) Records indicate material was removed in 2002 by PARC Specialty Contractors	n/a
M	Beige Speckled Sheet Vinyl Flooring	22	Assumed Positive	380 S	Restrooms	(1) Installed in 2002	N
M	Base Cove Adhesive	23	Assumed Positive	300 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	24	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	25	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Acoustic Ceiling Tile	26	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N

Z:\Client\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Siles\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: D

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	12" Beige with Brown Streaks Vinyl Floor Tile	27	5% CHRYSOTILE	2,700 S	Throughout	(1) Sample 46588 analyzed 2-25-89	N
M	12" White with Blue Spots Vinyl Floor Tile	28	Assumed Positive	250 S	Main Area	(1) Material may have been sampled in 1989, unable to confirm	N
M	Linoleum (Unknown Color)	29	30% CHRYSOTILE	380 S	Restrooms	(7) Records indicate material was removed in 2002 by PARC Specialty Contractors	n/a
M	Beige Speckled Sheet Vinyl Flooring	30	Assumed Positive	380 S	Restrooms	(1) Installed in 2002	N
M	Base Cove Adhesive	31	Assumed Positive	300 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	32	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	33	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Acoustic Ceiling Tile	34	Assumed Positive	3,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: E

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	Carpet Adhesive	35	Assumed Positive	4,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Vinyl Floor Tile (Unknown Color)	36	5% CHRYSOTILE	8,000 S	Throughout - may exist beneath currently visible carpet and vinyl floor tile	(11) Records indicate asbestos containing tile present in 1989, material may still exist beneath currently visible carpet and vinyl floor tile - Sample 46595 analyzed 2-25-89	N
M	12" Blue/Gray Mottled Vinyl Floor Tile	37	Assumed Positive	4,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Brown/Pink Rock Pattern Sheet Vinyl Flooring	38	Assumed Positive	50 S	Staff Restroom	(1) Material may have been sampled in 1989, unable to confirm	N
M	Base Cove Adhesive	39	Assumed Positive	150 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	40	Assumed Positive	12,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	41	Assumed Positive	12,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	4" Gray Ceramic Wall Tile	42	Assumed Positive	1,500 S	Restrooms	(1) Material may have been sampled in 1989, unable to confirm	N
M	Large Acoustic Ceiling Panels	43	Assumed Positive	6,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

THREE-YEAR REINSPECTION HOMOGENEOUS ACBM RECORDS

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: F

Material Class	Material	Hom. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	Blue Speckled Sheet Vinyl Flooring	44	Assumed Positive	1,000 S	Main room & restrooms	(1) Material may have been sampled in 1989, unable to confirm	N
M	12" Vinyl Floor Tile (Unknown Color)	45	5% CHRYSOTILE	3,500 S	Throughout - may exist beneath currently visible sheet vinyl and vinyl floor tile	(11) Records indicate asbestos containing tile present in 1989, material may still exist beneath currently visible sheet vinyl and vinyl floor tile - Sample 46598 analyzed 2-25-89	N
M	12" White Mottled Vinyl Floor Tile & Green Accent Tiles	46	Assumed Positive	1,800 S	Classrooms	(1) Material may have been sampled in 1989, unable to confirm	N
M	Base Cove Adhesive	47	Assumed Positive	150 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	Drywall & Joint Compound	48	Assumed Positive	4,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
S	Drywall Texture	49	Assumed Positive	4,000 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
M	2'x4' Ceiling Panels	50	Assumed Positive	3,600 S	Throughout	(1) Material may have been sampled in 1989, unable to confirm	N
						Building Scheduled for Demolition Summer of 2018	

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (if Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: Shed A

Material Class	Material	Homo. Mat. #	% Asb.	Ft ² /L.F.	Location	Condition: Code & Comments	Fiabile Yes/No
M	Drywall & Joint Compound	51	Assumed Positive	1,000 S	Interior	(1)	N

Z:\Clients\Yolo County Office of Education\16-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: Shed B

Material Class	Material	Homo. Mat. #	% Asb.	F ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
						Shed inaccessible, maintenance personnel indicated no suspect materials present	

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

- General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

**THREE-YEAR REINSPECTION
HOMOGENEOUS ACBM RECORDS**

Date of Inspection: June 7, 2018

District: Yolo County Office of Education

Inspector: Blake Howes

School: Greengate School

Building: Maintenance

Material Class	Material	Homo. Mat. #	% Asb.	Fr ² /L.F.	Location	Condition: Code & Comments	Friable Yes/No
M	Base Cove Adhesive	52	Assumed Positive	30 S	Throughout	(1)	N
M	Drywall & Joint Compound	53	Assumed Positive	2,000 S	Throughout	(1)	N
S	Drywall Texture	54	Assumed Positive	2,000 S	Throughout	(1)	N

Z:\Clients\Yolo County Office of Education\18-4796 Greengate School - 3 Year Reinspection\Sites\Greengate School\Greengate School - HMR.wpd

CONDITION CODE

General Condition: (1) Good (2) Damaged (3) Significantly Damaged (25% or more)
 Change in Condition: (4) No (5) Yes (If Yes, explain under comments)
 Abated: (6) Repaired (7) Removed (8) Encapsulated (9) Enclosed (10) Isolated & Restricted
 Miscellaneous: (11) Inaccessible, no inspection data (12) Other (Explain under comments) (13) Non-Asbestos/Not Inspected

CONSULT ORIGINAL AND SUPPLEMENTARY INSPECTION REPORTS FOR MATERIALS WITH TRACE AMOUNTS OF ASBESTOS

ENTEK CONSULTING GROUP, INC.
ASSESSMENT OF TSI and/or FRIABLE MATERIAL

District: Yolo County Office of Education Date: June 7, 2018

School: Greengate School Inspector: Blake Howes

Building & Location(s): Building A, Principal's Office & Conference Room

Sample # 46569 % Asbestos : 10% Chrysotile Homogeneous Mat. # 9

Material Description: Spray Applied Acoustic Ceiling Material

Total amount of material this location: 600 S Amount of friable material this location: 600 S

Damage	Local		Distributed		Damaged	0%
Type of Damage	Air Erosion		Water		Flaking	
	Deterioration		Physical		Delamination	

Probable cause(s) of damage:

POTENTIAL FOR DISTURBANCE			RESPONSE ACTIONS		PREVENTIVE MEASURES	
	H	M	L			
				Isolate/Restrict		Fix leaks
Accessibility		x		Repair/Cleanup		Prevent water contact
Vibration			x	Enclose		Do not drill, cut, sand, or grind x
Air Erosion			x	Remove		Do not affix signs x
Water			x	Encapsulate		Avoid contact x
Occupancy		x		O & M	x	

Assessment of Material Condition

Significantly Damaged (Poor) Damaged (Fair) Not damaged (Good)




Potential Damage: High High Mod Low High Mod Low

Hazard Ranking: 1 2 3 4 5 6 7

							X	
--	--	--	--	--	--	--	---	--

Comments & Observations:

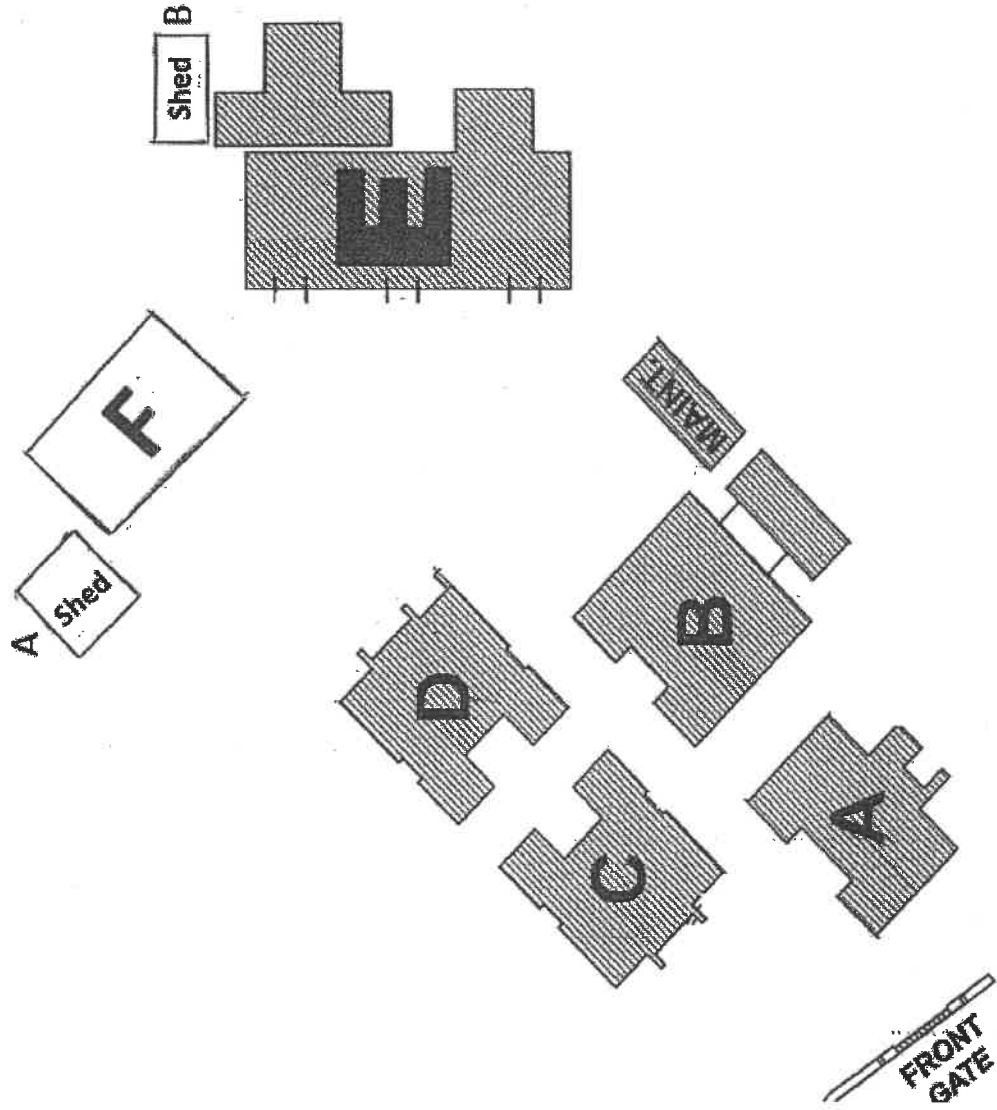

Blake Howes

AHERA 3 Year Reinspection
 Performed by: Blake Howes
 June 7, 2018
 Project #18-4796

Entek Consulting Group, Inc.
 4200 Rocklin Road, Suite 7
 Rocklin, CA 95677
 Map Not to Scale

Yolo County Office of Education
 Greengate School
 285 West Beamer Street
 Woodland, CA 95695